

876 Otter Creek Road Oregon, Ohio 43616-3518 Phone: (419) 698-3500 Fax (419) 698-8663 Website: <u>www.crystal-clean.com</u>

April 11, 2025

VIA ELECTRONIC MAIL

Mr. Michael Terpinski Ohio EPA, NWDO, DERR 347 North Dunbridge Road Bowling Green, OH 43402

Re: Envirosafe Services of Ohio, Inc. EPA Identification Number: OHD 045 243 706 March 2025 Progress Report

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), Envirosafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning March 1, 2025 and ending March 31, 2025.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

- 1. Leachate system maintenance included:
 - Inspection of piezometers and recovery wells on SWMUs 5, 6, and 7:
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
 - Evaluation of the SWMU 5 electrical system breaker tripped and would not reset;
 - Evaluation of the SWMU 7 electrical system pumps not operating;
 - Many wells with control panels were suspected to have frozen lines impacting readings throughout the month;
 - RW-3: Displaying negative level pump and transducer stuck in well maintenance scheduled;
 - PZ-13: Pump stuck in well and inoperable assessing replacement;
 - DPW-22: Transducer unresponsive replacement scheduled; and
 - NRP-26: Observed above hi point reset breakers, worked pump starter, pulled pump, cleaned pump screen, left soaking in Liquinox verified working in PVC sleeve and placed back in well pumping level down;
 - NRP-27: Displaying low level cleaned transducer and left to soak in CLR placed back in well working correctly;

Mr. Michael Terpinski April 11, 2025 Page 2

- NRP-30: Displaying negative level cleaned and inspected transducer transducer end left soaking in CLR until SWMU-7 electrical issues resolved;
- NRP-32: Observed not pumping pulled pump and cleared sand from screen, repaired two holes in airline began pumping;
- NRP-35: replaced display (previously faint and intermittent);
- SWMU 6 Compressor: emptied condensation bucket compressor and attic fan observed to be functioning as designed; and
- 2. NAPL Recovery System NAPL levels observed as skim to not present absorbent socks observed with available capacity.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:

During the next reporting period it is anticipated that the following activities will occur:

- 1. Diagnose and schedule repair of electrical systems for SWMU 5 and SMWU 7;
- 2. RW-1 Replacement of test valve scheduled for April part not available locally and being ordered;
- 3. RW-3 free stuck pump and repair/replacement of transducer not urgent or impacting TLL;
- 4. PZ-13 Replacement of damaged riser, discharge line and pump if needed active as piezometer;
- 5. DPW-22 Replacement of transducer not urgent or impacting TLL;
- 6. NRP-30 Replacement of transducer; and
- 7. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact me at (224) 723-8215.

Mr. Michael Terpinski April 11, 2025 Page 3

Sincerely,

Stephen J. DeLussa

Corporate Director – TSDF Compliance

ec: Franklin Irelan, ESOI Gary Deutschman, Ohio EPA-NWDO, DERR Mark Nielsen, BBJ Group Kristofer Mann, ESOI Dawn Pleiman, Ohio EPA-NWDO, DERR Michael Momenee, The Mannik & Smith Group